

# Partial Discharge Detection using Rogowski Coil Sensor on Medium Voltage Aerial Bundle Cable

N. Rameli, H. S. A. Halim, M. I. Nor Azli, T. Marie Anthony, M. A. Pangah@Pa'at, M. F. Ibrahim and N. A. Arifin

**Abstract**— It is well known that the internal partial discharge (PD) are small electric sparks that occurred due to defect in power cable insulation. This will lead to premature failure of cable which consequently interrupt the supply on the distribution lines. In this paper, the results of internal partial discharge detected by Rogowski coil (RC) sensor were presented. The RC sensors were designed, fabricated and tested in the laboratory with varying high frequency sinusoidal and impulse signals. An artificial PD defect was also created inside a straight through joint (STJ), medium voltage aerial bundle cable (MVABC) to generate PD signals. PD testing data in the laboratory were collected and analysed. Results indicate that the RC sensors are able to detect injected continuous sinusoidal signal at lower frequencies ranging from 0.5 MHz to 10 MHz. The detected PD signal generated from artificial PD defect from RC sensor was found to be slightly higher amplitude as compared to commercial PD sensor, High Frequency Current Transformer (HFCT). Thus findings show that the RC sensor is able to be used as a sensor to detect the internal partial discharge at MVABC specifically at STJs.

**Index Terms**—Medium voltage aerial bundle cable, Partial discharge, Rogowski coil, Straight through joint

## I. INTRODUCTION

Partial discharges (PD) are small electric sparks or discharges that occur due to defect in electrical insulation. In medium voltage (MV) cable systems, PD mostly occur at the cable joints due to poor workmanship during the cable jointing, aging or exposed to surrounding environment [1-5]. Consequently, PD can cause damage to the insulation of cable joint leading to unexpected premature failure of cable [6, 7].

In TNB Distribution Network (DN), medium voltage aerial bundle cables (MVABC) are installed on the overhead system [8,9]. Up to year of 2019, this installation covers 18, 595 km MVABC for voltage level 11 kV and 33 kV.

This manuscript is submitted on 7<sup>th</sup> August 2020 and accepted on 25<sup>th</sup> November 2020. Norhidayu Rameli, Huzainie Shafi Abd. Halim, Tashia Marie Anthony, Mohd Azraei Pangah @ Pa'at, Muhammad Faiz Ibrahim and Nur Amira Nor Arifin are with TNB Research Jalan Ayer Itam, 43000, Kajang, Selangor (email: norhidayu.rameli@tnb.com.my).

Muhd. Irfan Nor Azli is from College of Engineering, Universiti Tenaga Nasional, Jalan IKRAM-UNITEN, 43000 Kajang, Selangor.

1985-5389/© 2021 The Authors. Published by UiTM Press. This is an open access article under the CC BY-NC-ND license (<http://creativecommons.org/licenses/by-nc-nd/4.0/>).

On top of that, the MVABC have also been in-service for more than 15 years which may have experienced aging that might lead to the degradation of the cable joints.

A lot of work and study has been done to detect and locate the partial discharge at medium voltage (MV) cable [10-12]. It includes the measuring method and analyzing techniques to identify the PD activities which mostly for the medium voltage underground cable. However, little information has been carried out regarding the PD detection for MVABC overhead system. MVABC at the overhead system are insulated cable that have similar construction to MV underground cable. It consists of aluminium conductor, conductor screen, XLPE insulation, insulation screen, metallic screen, separator and the outer sheath. The only difference between them are MVABC at the overhead system consist a messenger wire which functional to provide mechanical strength and assist fault current return when system exposed to the short circuit. The MVABC cables are hanging at the pole which exposed with the sunlight, wind and usually long length installation.

Due to long length installation, it is difficult to measure PD at the end of the cable as PD signal tend to attenuate and disperse whilst propagating along the long length cable. Hence, alternative devices to detect or measure the internal discharge need to be explored on the MVABC overhead system specifically at STJs in order to avoid the unexpected premature failure. Therefore, this paper discuss on partial discharge detection device using RC sensor on MVABC STJs.

## II. DEVELOPMENT OF RC SENSOR

When a partial discharge pulse occurs, there is a very fast flow of electrons from one site of the gas filled void to the other side. The moving flow of these electrons causes a PD current and voltage pulses that flow away from the PD sites. Typically these pulses are very short duration, mostly in range few nanoseconds. In other word, the PD signal represent a pulses with very short duration of high frequency signal. This signal shall be detected by alternative device sensor whereby the this signal can be sensed from energised released method such as electrical charge, electromagnetic wave and acoustic noise [13]. For MV cable, the electrical charge seems reasonable sensed since the detection methods are either in current or voltage pulses detection whereby the RC sensor is belongs to the group of current pulse detection. Details on the development of the RC sensor explained in next section.

A. RC sensor design

The RC sensor will be used to detect partial discharge from MV power cable. Since the rate of change of the magnetic field is directly proportional to the number of turn per length of the coil, the output voltage of a RC sensor can be defined by Eq. (1)

$$V_0 = N \frac{dB}{dt} \quad (1)$$

Whereby  $V_0$  is the output voltage,  $N$  is the number of turns per length and  $B$  is the magnetic field. Taking into consideration of permeability of the core, following Eq. (2) to (5) are obtained.

$$V_0 = N \frac{d(BA)}{dt} \quad (2)$$

$$V_0 = NA \frac{dB}{dt} \quad (3)$$

$$V_0 = NA \frac{d}{dt} \left( \frac{\mu_0 \mu_r}{2\pi r} \right) \quad (4)$$

$$V_0 = NA \left( \frac{\mu_0 \mu_r}{2\pi r} \right) \frac{di}{dt} \quad (5)$$

Whereby  $r$  is the radius of coil,  $\mu_0$  is the permeability of air,  $\mu_r$  the relative permeability of coil,  $A$  is the cross sectional area and  $i$  is the current flowing in the conductor due to the mutual inductance.

Substitute inductance  $K$ , angular frequency  $\omega$  and current  $i$  into Eq. (5), the simplified output voltage equation as shown in Eq. (6)

$$V_0 = jK\omega i \quad (6)$$

Thus, sensitivity design of the RC sensor,  $K$  based on the Eq. (7)

$$K = NA \left( \frac{\mu_0 \mu_r}{2\pi r} \right) \quad (7)$$

Whereby  $r$  is the radius of coil,  $\mu_0$  is the permeability of air,  $\mu_r$  the relative permeability of coil,  $A$  is the cross sectional area and  $N$  is the numbers of turn.

By increasing the number of turns and cross-sectional area of the core, the sensitivity of the RC will be increased which consequently able to detect lower amplitude signal. In this design, a solid ferrite core with a permeability of 100-1000 H/m and 1 cm diameter was selected. As shown in Fig.1, ten pieces of solid ferrite core that made up a length of 40 cm was prepared and coiled with two loops of conductors.

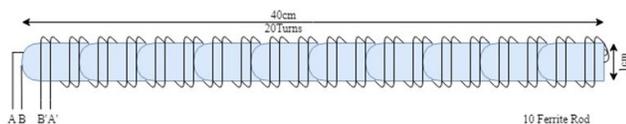


Fig. 1. The structural design of RC sensor

With the use of ten (10) pieces solid ferrite core, the structural design was considered to be flexible RC as shown in Fig.2.

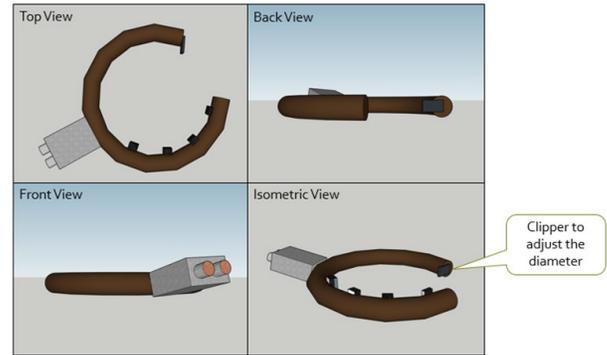


Fig. 2. Flexible RC sensor design

B. Fabrication of RC sensor

In total, fifteen (15) RC sensors were fabricated. Fig. 3 shows the prototype of RC sensor and casing are made of Acrylonitrile Styrene Acrylate (ASA) using a 3D printer. The prototype RC sensor employed exceptional strength, rigidity and rated as IP65 ingress protection. The core of the coil are protected by two layers of heatsink and wrapped in poly tape with 80°C maximum operating temperature.



Fig. 3. Prototype of RC sensor

III. LABORATORY TEST FOR RC SENSOR

The laboratory test was performed to verify the functionality of the RC sensor as a PD detection sensor. This test includes;

- Laboratory test using the continuous sinusoidal test waveform at different high frequencies
- Laboratory test using the impulse test waveform at different high frequencies
- Laboratory test using the artificial PD defect signal

A. Laboratory test using continuous sinusoidal test waveform at different high frequencies

In total, fifteen (15) RC sensors were fabricated and tested in laboratory. These test is to verify whether the RC sensors can detect high frequencies continuous sinusoidal signal and the performances were compared with HFCT. The continuous

sinusoidal test waveform were injected to cable using a waveform generator with an amplitude of 3 V p-p and frequencies were varies from 0.5 MHz to 30 MHz. The RC sensors were connected onto a differential amplifier as it uses a centre tap design where the detected amplitude will be doubled in order to increase sensor sensitivity. All detected and measured signals from waveform generator via RC sensors were analysed.

**B. Laboratory test using impulse test waveform at different high frequencies**

During partial discharge occurrence, a current pulse is produced. In order to simulate a partial discharge, the Waveform Generator is set to generate pulse wave with amplitude of 3 V p-p. The frequency repetitive of the set-up circuit is constant at 10 kHz with pulse width is varied from 0.1 μs (10 MHz) to 1 μs (1MHz) as shown in Fig.4. All detected and measured signal from waveform generator via RC sensors were analysed.

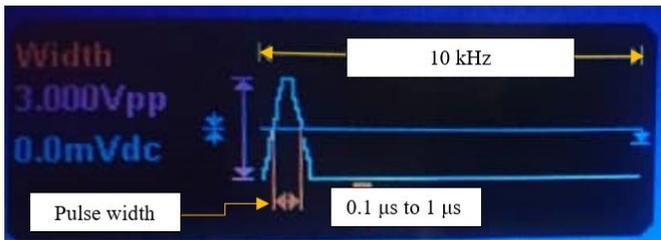


Fig. 4. Input impulse test waveform

**C. Laboratory test using the artificial PD defect**

The artificial PD defect as shown in Fig. 5 was created in the MVABC joint of 11 kV 3C X 240 mm<sup>2</sup> + 50 mm<sup>2</sup> MVABC cable. The artificial PD defect was created by damaging the insulation screen cut back of the cable. The insulation screen cut back of the cable were indented to create an air pocket later covered by the insulation layer of the joint.

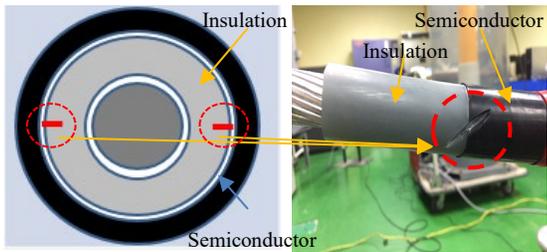


Fig. 5. Artificial PD defect at MVABC joint

MVABC with PD defect was tested at the laboratory as shown in Fig. 6. Both RC sensor and HFCT were clamped at the earth braid of the cable. The MVABC cable was injected with  $U_0$  test voltage. The PD signal was captured by RC and HFCT, connected to the oscilloscope and analysed.

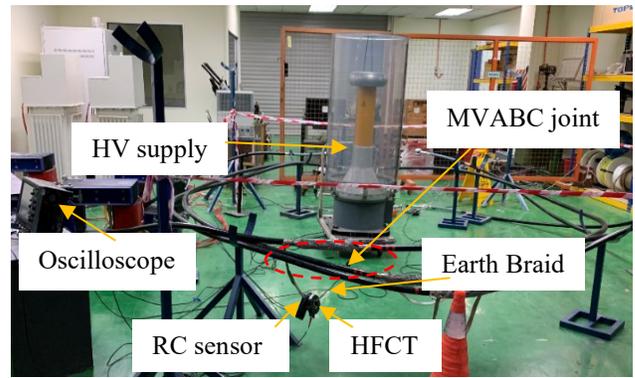


Fig. 6. Laboratory test set-up for artificial PD defect at MVABC joint

**IV. RESULTS AND DISCUSSIONS**

Results and discussions in this paper covers the laboratory test using continuous sinusoidal test waveform at different high frequencies input signal, impulse test waveform at different high frequencies input signal and PD signal from the artificial PD defect to verify the functionality of the RC sensor as a PD detection sensor.

Fig. 7 shows the comparison of voltage amplitude detected by RC sensor and HFCT using continuous sinusoidal test waveform at different high frequencies input signal. The frequency was varied from 0.5 MHz to 30 MHz.

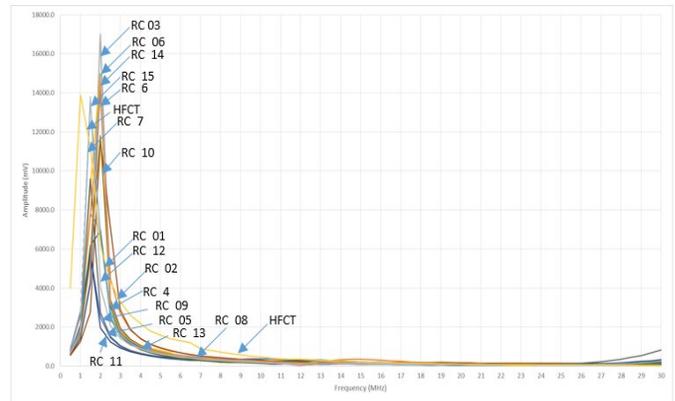


Fig. 7. voltage amplitude detectin by RC and HFCT sensor at various frequency

From figure above, both of the sensors, RC sensors and HFCT successfully detects injected continuous sinusoidal signal amplitude at lower frequencies, 0.5 MHz to 10.0 MHz. It was observed that the amplitude detected decreases as the frequency increase. The result also shows that the RC and HFCT sensor reached highest amplitude at frequency range of 1.5 MHz to 3 MHz which indicate that the RC and HFCT sensors have higher sensitivity at low frequencies of continuous sinusoidal signal.

Fig. 8 shows the voltage amplitude in each impulse test duration. The pulse wave width were varied from 0.1 μs (10 MHz) to 1 μs (1MHz) injected to a cable. HFCT and several RC sensors were clamped onto the cable to observe and assess the sensor detectability. The results shows that the voltage

amplitude increase as the pulse duration increase. This indicates that the sensor able to detect signal frequency from 1 MHz to 10 MHz with high gain on the lower frequency range.

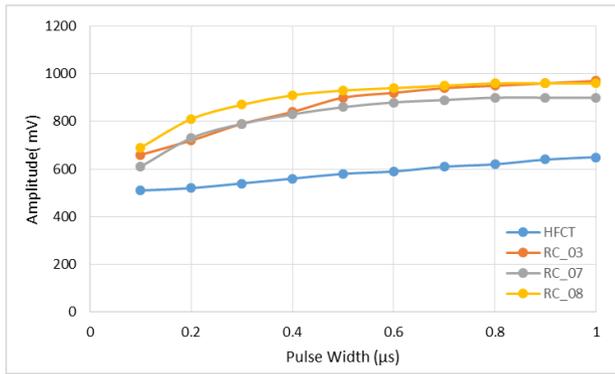


Fig. 8- Pulse duration set versus voltage amplitude

For HFCT, the amplitude gain was observed to be more stable as only slightly increases throughout the test frequency range as compared to RC sensor. However amplitude gain for RC sensor at higher frequency range was observed to be higher compared to the HFCT thus exhibited better sensitivity. Table I shows the detected pulse signals waveform of the sensors at 0.1µs (10 MHz) and 1µs (1MHz).

TABLE I  
PULSE SIGNAL DETECTED COMPARISON

Pulse Width	0.1µs	1µs
HFCT		
RC_03		
RC_07		
RC_08		

Fig. 9 shows the results of RC sensor detecting the PD signal from artificial PD defect. The oscilloscope was used to display PD signals which indicate that the RC sensors able to detect the artificial PD defect signal as well as the HFCT sensor. PD testing was repeated for five (5) times (D1 to D5). The test results were tabulated in Table II. The average detected PD signal amplitude from artificial PD detected by RC sensor is 5.38 mV and 4.07mV for HFCT sensor. The detected PD signal frequency is 2.5 MHz or 0.4 µs pulse width. This is in line with previous impulse voltage test where at 0.4 µs, RC sensors have higher amplitude gain compared to HFCT sensor.

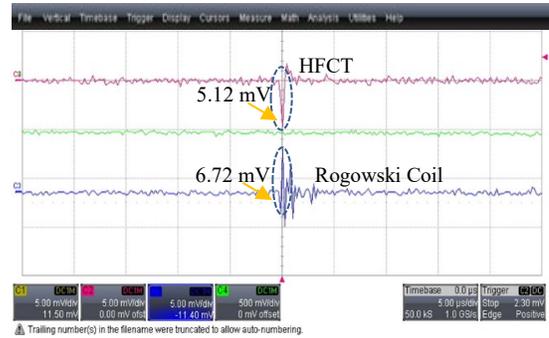


Fig. 9. Artificial PD defects result detected using RC and HFCT sensor

TABLE II  
DATA COLLECTED USING THE ARTIFICIAL PD DEFECT

Data	Oscilloscope Channel (CH)	Max Peak (mV)
D1	CH 2- HFCT sensor	3.84
	CH 3- RC	5.44
D2	CH 2- HFCT sensor	5.12
	CH 3- RC	6.72
D3	CH 2- HFCT sensor	4.03
	CH 3- RC	5.76
D4	CH 2- HFCT sensor	4.16
	CH 3- RC	5.12
D5	CH 2- HFCT sensor	3.20
	CH 3- RC	3.84
Average for 5 data collected	CH 2- HFCT sensor	4.07
	CH 3- RC	5.38

In this study, the functionality of RC sensors as a PD detection sensor were tested and verified in the laboratory via continuous sinusoidal waveform, impulse waveform and PD signal generated from artificial created PD defect in actual high voltage cable. Further verification shall be carried out at actual MVABC in utility distribution network. The sensitivity of the RC sensor can be further improved by increasing the numbers of turn and diameter core thus able to increase the sensitivity. However low level surrounding noise signal need to be considered if to develop high sensitive sensor. An appropriate signal filtration is needed to reject those unwanted low level noise signal.

## V. CONCLUSIONS

Partial discharge detection using Rogowski Coil sensor on the Medium Voltage Aerial Bundle Cable was found to be able to detect the internal partial discharge, specifically at the MVABC joint. Based on laboratory test, the sensor comfortably able to detect frequency range from 0.5 MHz to 10 MHz. Based on laboratory experiment using actual high voltage cable sample with artificially created PD defect, the newly developed RC sensor is expected can be used to detect PD signal in MVABC joint.

## ACKNOWLEDGEMENTS

The authors would like to acknowledge TNB Research Sdn Bhd and UNITEN R&D for their kind supports and advisable throughout this project. Special thanks also goes to those who directly or indirectly contributed to this project.

## REFERENCES

- [1] IEEE Guide for Partial Discharge Testing of Shielded Power Cable Systems in a Field Environment, IEEE Standard 400.3TM-2006, 2007.
- [2] E. Gulski, J.J. Smit and F.J. Wester, "PD knowledge rules for insulation condition assessment of distribution power cables", *IEEE Transaction on Dielectric and Electrical Insulation*, vol.12, no.2, 2005.
- [3] M. Batalović, H. Matoruga and M. Matoruga, "Investigation on partial discharge activity inside the cable accessories due to improper installation of power cable joints", *International Conference on Smart Technologies (IEEE EUROCON)*, Serbia, 1-4 July 2019.
- [4] Y. Tian and P. Lewin, "Comparison of on-line partial discharge detection methods for hv cable joints", *IEEE Transaction on Dielectric and Electrical Insulation*, vol.9, no.4, 2002.
- [5] D.F. Clinton and C. Nyamupangedu, "Partial discharge characterization of cross-linked polyethylene medium voltage power cable termination defects at very low frequency (0.1 Hz) and power frequency test voltages", *IEEE Electrical Insulation Magazine*, vol. 32, Issue. 4, 2016.
- [6] Z. Ahmed, G. A. Hussain, M. Lehtonen, L. Varacka and J. Kudelcik, "Analysis of partial discharge signals in medium voltage XLPE cables", *International Scientific Conference on Electric Power Engineering (EPE)*, Prague, Czech Republic, May 2016.
- [7] M.S. Mashikian and A. Szarkowski, "Medium voltage cable defects revealed by off-line partial discharge testing at power frequency", *IEEE Electrical Insulation Magazine*, vol. 22, issue. 4, 2006.
- [8] Asset Management Department, "Condition Based Maintenance for Medium Voltage Bare Overhead Lines" Wisma TNB Jalan Timur, Petaling Jaya Selangor, July, 2013.
- [9] Manual Kabel Bertebat Seikat di Udara Voltan Tinggi (HV ABC), Unit Perkhidmatan Kejuruteraan, Jabatan Pengurusan Aset, Bahagian Pembahagian, TNB, Mei 2013.
- [10] M. Shafiq, G. Robles, A. Hussain, K. Kauhaniemi and M. Lehtonen, "Identification and location of partial discharge defects in medium voltage AC cables", *Nordic Insulation Symposium on Materials, Components and Diagnostics (NORD-IS 19)*, Tampere, Finland, 2019.
- [11] B. Sheng, C. Zhou, D. M. Hepburn, X. Dong, "partial discharge pulse propagation in power cable and partial discharge monitoring system", *IEEE Transactions on Dielectrics and Electrical Insulation*, vol. 21, no.3, June 2014.
- [12] D.F. Jingle Jabha, K. Selvi and R. Joselin, "Investigation of partial discharge in power cables using artificial neural network and PD analyzer", *Journal of Electrical Engineering*, January 2016.
- [13] M.M. Yaacob, M.A. Alsaedi, J.R. Rashed, A.M Dakhil and S.F. Atyah, "Review on partial discharge detection techniques related to high voltage power equipment using different sensors", *Photonic Sensors*, vol. 4, no. 4, pp. 325-337, 2014.



**Norhidayu Rameli** graduated from Universiti Putra Malaysia with B. Eng degree in Electrical and Electronic in 2010. In 2013 and 2017, she completed her studies in MSc and PhD, respectively in Electrical Power Engineering. Currently she is Researcher at High Voltage Cable Diagnostics, Asset Performance Unit, TNB Researcher Sdn Bhd. Her research interests includes High Voltage, Power Cable, Cable Diagnostic and Testing, Lightning Protection, Lightning Induced Voltage and Insulation Coordination Studies.



**Ir. Ts. Huzainie Shafi Abd. Halim** received his B. Eng. (Hons) in Electronic and Electrical Engineering from the University of Portsmouth, UK in 1997. Upon graduation, he worked with ABB (Malaysia) Transmission & Distribution as a Protection Design Engineer. Since 1998, he has been employed by TNB Research as a Research Engineer with Product Design and Prototyping Group. In 2000 he joined the High Voltage Diagnostic Research Group in TNB Research. He obtained his M. Eng. in Electrical Engineering from University Tenaga Nasional in 2010. He is a member of Board Engineer Malaysia, Institute Engineer Malaysia and Malaysia Board of Technologies. His main focus area lies with cable insulation diagnostic and measurements. Presently he is a Technical Expert of Power Cable in TNB Research.



**Muhd. Irfan Nor Azli** received his B. Eng. (Hons.) degree in Electrical and Electronics in 2018 and currently pursuing his M. Eng in Electrical Engineering at Universiti Tenaga Nasional. In 2019, he was a Research Assistant at Radio Frequency and Microwave Unit under UNITEN R&D. His area of research focuses on partial discharge detection, high-voltage, overhead power cables, high frequency transformer and power cable diagnostic.



**Tashia Marie Anthony** graduated from Universiti Tenaga Nasional with Bachelor of Electrical & Electronics Engineering (Hons.) in 2008. She is currently Senior Researcher at High Voltage Cable Diagnostic, Asset Performance Unit, TNB Research Sdn. Bhd. Her experiences mainly in cable diagnostics and testing as well as cable ampacity calculation and research related to cable insulation ageing.



**Mohd Azraei Pangah @ Pa'at** graduated from Universiti Tenaga Nasional with Bachelor of Engineering degree (Hons.) in Electrical Power System in 2012. He has been acknowledged as a professional engineer in 2019. He is currently a principal researcher at High Voltage Cable Diagnostic, Asset Performance Unit, TNBR. His research focused towards

Power Cable Testing, Diagnostic and Life Assessment.



**Muhammad Faiz Ibrahim** obtained Bachelor of Electronic Engineering (Communication) (Hons) in 2016 from Universiti Teknologi MARA, Shah Alam. He is currently a researcher at High Voltage Cable Diagnostics, Asset Performance Unit, TNB Research Sdn Bhd. His research interest is in the area of power and energy engineering.



**Nur Amira Nor Arifin** graduated from Universiti of Malaya with Bachelor of Science Physic degree (Hons.) in 2013. She is currently Researcher at High Voltage Cable Diagnostic, Asset Performance Unit, TNB Research Sdn. Bhd. She is experienced and trained in Medium Voltage underground cable specially in material power cable. She is

involved in various projects related to material including on XLPE Based Nanocomposite for MV cable and effect of duct fillers materials towards cable temperature and ampacity.